

Fremont Bear Foot Snare Complete

FRBEFOSN - Comes with 1 Fremont Snare Thrower, 1 Snare, 1 High Tie Cable and 1 Quick Link.

Also available:

- # FRBEVI - Video - Bear Trapping with the Fremont Bear Foot Snare.
- # FR1 - Bear Replacement Snare - 3/16", 7 x 19 Galv. Aircraft Cable
- # FR2 - Wolf Replacement Snare - 1/8", 7 x 7 Galv. Aircraft Cable
- # FR2 - Wild Boar Repl. Snare - 1/8", 7 x 7 Galv. Aircraft Cable
- # FRHITI - High Tie Cable Replacement - 3/16, 7 x 7 Galv. Airc. Cable
- # PLSCCO - 9" Plastic Screen Pan Covers
- # QU516 - Heavy Duty Quick Links - 5/16"
- # BELO - Bear Lock for 3/16 cable
- # HDSW - Heavy Duty Swivels - Highly recommended for Wolf and Wild Boar, can also be used for Bear.


Custom made, 3/8" welded eye bolt, 120 wall body, illustrated opposite.



**FREMONT BEAR FOOT SNARE
INSTRUCTION SHEET**



Use extreme caution when setting the Fremont Snare Thrower!

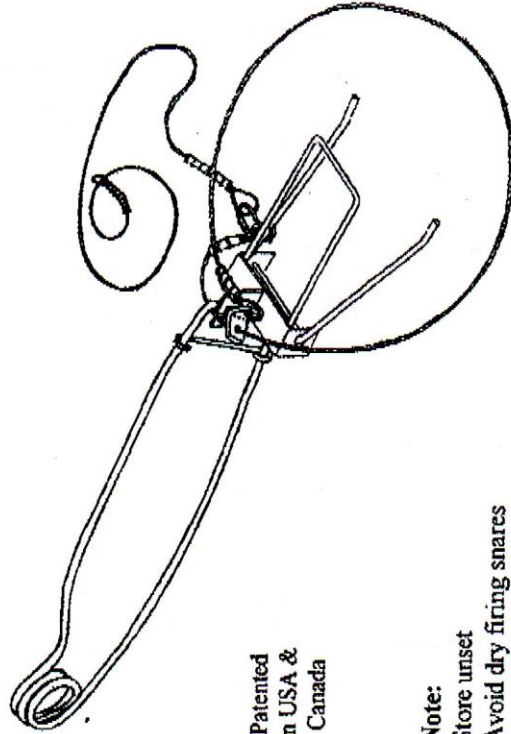

Patented in USA & Canada

Note:
Store unset
Avoid dry firing snares

TREATING THE SPRING

The spring and snare assembly can be boiled in logwood dye or liquid trap dye - Andy Stoos Speed Dip or Aarons dye.
Do not wax the trap.


SETTING THE FREMONT SNARE THROWER

1. Connect formed snare eye to formed eye on the high tie cable with heavy duty quick link.
2. Slip either one of the support legs of the thrower into the snare eye with the quick link attached. Shown on Figure A. Work with the lay of the cable so the snare lays flat.

Note: After a catch is made, the snare eye pulls off the support leg, freeing the snared animal from the thrower.



BEAR PEN SET

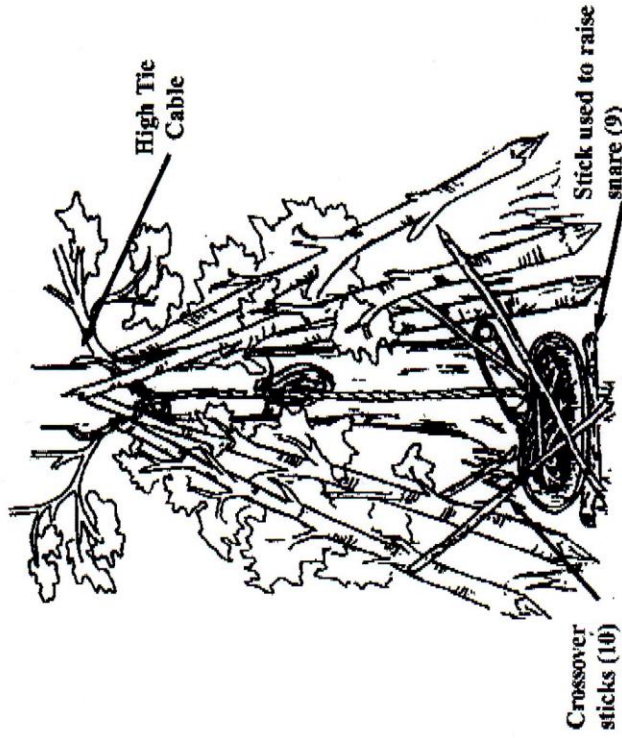

3. Open the snare loop making sure cable is engaged in thrower eye along with the pan trigger. See figure B on last page.
4. Prepare an elongated trench 4" deep for the spring and 4" deep by 8" in diameter for the pan area.
5. Place the thrower in the prepared trench and anchor the end of the high tie solidly to a tree or drag.
6. Set the thrower spring by pressing down on the upper arm. **IMPORTANT - ENGAGE THE SAFETY HOOK!**
7. Engage the trigger by lifting up the pan.
8. Cover pan with 9" fibreglass trap pan cover, then cover lightly with debris or snow.
9. Open the snare loop and place around the pan. Raise the snare about 2" above the pan, using sticks.
10. **PLEASE NOTE** - you want the snare loop farthest from the thrower at least 2" above the pan. This will ensure that when the bear steps down on the pan, the snare loop is already fairly high on his leg. This also prevents the snare from freezing down after a snowfall.

11. Carefully disengage the safety hook.
12. Finally a step over stick or crossed sticks may be placed on one or two sides of the set to guide the animal's foot on the pan. See picture of bear pen set.

TIP: For bear, the high tie cable should be looped around a 6" tree as high as possible. A lunging animal will be lifted up off the ground preventing any solid jerks.

ATTRACTING BEAR TO YOUR SET:

Make a cubby, as illustrated on previous page, close to a known bear path. Pre-baiting with bakery goods, oats & molasses or beaver meat will help. Always bag or wire bait to the back of cubby to make the bear work the set. For lure use anise oil. Trail sets work where bears establish a path. Use cross sticks to force the bear to step on pan.

SETTING FOR WOLF AND COUGAR

Use Snare No. FR2 - 1/8 cable with the Fremont Bear Foot Snare. The same setting instructions apply as for bear. The high tie cable can be fastened to a drag. See illustration below.



Note:
Trail set illustrated prior to covering trap.